# SAFETY DATA SHEET

# SECTION 1) CHEMICAL PRODUCT AND SUPPLIER'S IDENTIFICATION

Product ID: AAD MULTI-PURPOSE ADHESIVE
Product Name: AAD MULTI-PURPOSE ADHESIVE

Revision Date: Sep 15, 2017

Version: 1.0

Distributor's Name: AUTO ACCESSORY DISTRIBUTING

Address: 8335 SE DIVISION ST - PORTLAND, OR 97266

Emergency Phone: 1-800-535-5053 Information Phone Number: (800) 547-8919

Fax:

Product/Recommended Uses: Mist Spray Adhesive

# **SECTION 2) HAZARDS IDENTIFICATION**

#### Classification

Acute toxicity Dermal - Category 5

Acute toxicity Oral - Category 5

Aerosols Category 1

Eye Irritation - Category 2A

Skin Irritation - Category 2

Specific Target Organ Toxicity -Single Exposure (Narcotic Effects) - Category 3

### **Pictograms**





### Signal Word

Danger

# **Hazardous Statements - Health**

H313 - May be harmful in contact with skin

H303 - May be harmful if swallowed

H319 - Causes serious eye irritation

H315 - Causes skin irritation

H336 - May cause drowsiness or dizziness

### **Hazardous Statements - Physical**

H222 - Extremely flammable aerosol

H229 - Pressurised container: May burst if heated

### **Precautionary Statements - General**

P101 - If medical advice is needed, have product container or label at hand.

P102 - Keep out of reach of children.

P103 - Read label before use.

Supersedes Date: Dec 14, 2016

**DATE PRINTED: 10/1/18** 

### **Precautionary Statements - Prevention**

- P210 Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.
- P211 Do not spray on an open flame or other ignition source.
- P251 Do not pierce or burn, even after use.
- P264 Wash thoroughly after handling.
- P280 Wear protective gloves/protective clothing/eye protection/face protection.
- P261 Avoid breathing dust/fume/gas/mist/vapors/spray.
- P271 Use only outdoors or in a well-ventilated area.

### **Precautionary Statements - Response**

- P312 Call a POISON CENTER or doctor/physician if you feel unwell.
- P305 + P351 + P338 IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.
- P337 + P313 If eye irritation persists: Get medical advice/attention.
- P302 + P352 IF ON SKIN: Wash with plenty of soap and water.
- P332 + P313 If skin irritation occurs: Get medical advice/attention.
- P362 + P364 Take off contaminated clothing and wash it before reuse.
- P304 + P340 IF INHALED: Remove person to fresh air and keep comfortable for breathing.

#### **Precautionary Statements - Storage**

- P410 + P412 Protect from sunlight. Do not expose to temperatures exceeding 50 °C/122 °F.
- P403 + P405 Store in a well-ventilated place. Store locked up.

### **Precautionary Statements - Disposal**

P501 - Dispose of contents and container in accordance with all local, regional, national and international regulations.

### **SECTION 3) COMPOSITION, INFORMATION ON INGREDIENTS**

CAS	Chemical Name	% By Weight
0000079-20-9	METHYL ACETATE	38% - 63%
0000115-10-6	METHYL ETHER	17% - 29%
0000142-82-5	N-HEPTANE	2% - 4%

Specific chemical identity and/or exact percentage (concentration) of the composition has been withheld to protect confidentiality.

# **SECTION 4) FIRST-AID MEASURES**

### Inhalation

Remove source of exposure or move person to fresh air and keep comfortable for breathing.

If exposed/feel unwell/concerned: Call a POISON CENTER/doctor.

Eliminate all ignition sources if safe to do so.

# **Eye Contact**

Remove source of exposure or move person to fresh air. Rinse eyes cautiously with lukewarm, gently flowing water for several minutes, while holding the eyelids open. Remove contact lenses, if present and easy to do. Continue rinsing for a duration of 15-20 minutes. Take care not to rinse contaminated water into the unaffected eye or onto the face. If eye irritation persists: Get medical advice/attention.

# Skin Contact

Take off immediately all contaminated clothing, shoes and leather goods (e.g. watchbands, belts). Gently blot or brush away excess product. Wash with plenty of lukewarm, gently flowing water for a duration of 15-20 minutes. Call a POISON CENTER/doctor if you feel unwell. Store contaminated clothing under water and wash before reuse or discard.

### Ingestion

Rinse mouth. Do NOT induce vomiting. Immediately call a POISON CENTER/doctor. If vomiting occurs naturally, lie on your side, in the recovery position.

Never give anything by mouth to an unconscious or convulsing victim. Keep person warm and quiet.

# **SECTION 5) FIRE-FIGHTING MEASURES**

### Suitable Extinguishing Media

Use water, fog, dry chemical, or carbon dioxide.

Carbon dioxide can displace oxygen. Use caution when applying carbon dioxide in confined spaces. Simultaneous use of foam and water on the same surface is to be avoided as water destroys the foam.

#### **Unsuitable Extinguishing Media**

Water may be ineffective but can be used to cool containers exposed to heat or flame.

#### Specific Hazards in Case of Fire

Contents under pressure. Keep away from ignition sources and open flames. Exposure of containers to extreme heat and flames can cause them to rupture often with violent force.

Aerosol cans may rupture when heated.

Heated cans may burst.

In fire, will decompose to carbon dioxide, carbon monoxide

#### **Fire-Fighting Procedures**

Isolate immediate hazard area and keep unauthorized personnel out. Stop spill/release if it can be done safely. Move undamaged containers from immediate hazard area if it can be done safely. Water spray may be useful in minimizing or dispersing vapors and to protect personnel.

Dispose of fire debris and contaminated extinguishing water in accordance with official regulations.

### **Special Protective Actions**

Wear protective pressure self-contained breathing apparatus (SCBA)and full turnout gear.

Care should always be exercised in dust/mist areas.

# SECTION 6) ACCIDENTAL RELEASE MEASURES

# **Emergency Procedure**

Flammable material.

ELIMINATE all ignition sources (no smoking, flares, sparks, or flames in immediate area). Stay upwind; keep out of low areas. Immediately turn off or isolate any source of ignition. Keep unnecessary people away; isolate hazard area and deny entry. Do not touch or walk through spilled material. Clean up immediately. Use absorbent sweeping compound to soak up material and put into suitable container for proper disposal.

#### **Recommended Equipment**

Safety glasses, gloves.

#### **Personal Precautions**

ELIMINATE all ignition sources (no smoking, flares, sparks, or flames in immediate area). Use explosion proof equipment. Avoid breathing vapor. Avoid contact with skin, eye or clothing. Do not touch damaged containers or spilled materials unless wearing appropriate protective clothing.

# **Environmental Precautions**

Stop spill/release if it can be done safely. Prevent spilled material from entering sewers, storm drains, other unauthorized drainage systems and natural waterways by using sand, earth, or other appropriate barriers.

# **SECTION 7) HANDLING AND STORAGE**

### General

For industrial and institutional use only. For use by trained personnel only. Keep away from children. Wash hands after use.

Do not get in eyes, on skin or on clothing.

Do not breathe vapors or mists.

Use good personal hygiene practices.

Eating, drinking and smoking in work areas is prohibited.

Remove contaminated clothing and protective equipment before entering eating areas.

Eyewash stations and showers should be available in areas where this material is used and stored.

#### **Ventilation Requirements**

Use only with adequate ventilation to control air contaminants to their exposure limits. The use of local ventilation is recommended to control emissions near the source.

### **Storage Room Requirements**

Do not cut, drill, grind, weld, or perform similar operations on or near containers. Do not pressurize containers to empty them.

Store at temperatures below 120°F.

### **SECTION 8) EXPOSURE CONTROLS, PERSONAL PROTECTION**

### **Eye Protection**

Chemical goggles, safety glasses with side shields or vented/splash proof goggles. Contact lenses may absorb irritants. Particles may adhere to lenses and cause corneal damage.

#### **Skin Protection**

Wear gloves, long sleeved shirt, long pants and other protective clothing as required to minimize skin contact.

Use of gloves approved to relevant standards made from the following materials may provide suitable chemical protection: PVC, neoprene or nitrile rubber gloves. Suitability and durability of a glove is dependent on usage, e.g. frequency and duration of contact, chemical resistance of glove material, glove thickness, dexterity. Always seek advice from glove suppliers. Contaminated gloves should be replaced. Chemical-resistant clothing is recommended to avoid prolonged contact. Avoid unnecessary skin contact.

### **Respiratory Protection**

If engineering controls do not maintain airborne concentrations to a level which is adequate to protect worker, a respiratory protection program that meets or is equivalent to OSHA 29 CFR 1910.134 and ANSI Z88.2 should be followed. Check with respiratory protective equipment suppliers. Where air-filtering respirators are suitable, select an appropriate combination of mask and filter. Select a filter suitable for combined particulate/organic gases and vapors.

When spraying more than one half can continuously or more than one can consecutively, use NIOSH approved respirator.

Chemical Name	OSHA TWA (ppm)	OSHA TWA (mg/m3)	OSHA STEL (ppm)	OSHA STEL (mg/m3)	OSHA Tables (Z1, Z2, Z3)	OSHA Carcinogen	OSHA Skin designation	NIOSH TWA (ppm)	NIOSH TWA (mg/m3)	NIOSH STEL (ppm)	NIOSH STEL (mg/m3)	NIOSH Carcinogen
METHYL ACETATE	200	610			1			200	610	250	760	
N-HEPTANE	500	2000			1			85	350			

Chemical Name	ACGIH TWA (ppm)	ACGIH TWA (mg/m3)	ACGIH STEL (ppm)	ACGIH STEL (mg/m3)	
METHYL ACETATE	200	606	250	757	
N-HEPTANE	400	1640	500	2050	

# **SECTION 9) PHYSICAL AND CHEMICAL PROPERTIES**

### **Physical and Chemical Properties**

 Density
 7.10165 lb/gal

 Density VOC
 2.04218 lb/gal

 % VOC
 28.75645%

Appearance Clear mist
Odor Threshold N.A.
Odor Description Solvent
pH N.A.

Water Solubility Not soluble

Flammability Flashpoint below 73 °F

Flash Point Symbol

Flash Point

Viscosity

N.A.

Lower Explosion Level

N.A.

Upper Explosion Level

N.A.

Vapor Density Slower than ether

Melting Point N.A.
Freezing Point N.A.
Low Boiling Point N.A.
High Boiling Point N.A.
Decomposition Pt N.A.
Auto Ignition Temp N.A.

Evaporation Rate Slower than ether

# **SECTION 10) STABILITY AND REACTIVITY**

### Stability

Stable.

### **Conditions to Avoid**

High temperatures.

# **Incompatible Materials**

Strong oxidizing agents.

### **Hazardous Reactions/Polymerization**

Will not occur.

# **Hazardous Decomposition Products**

In fire, will decompose to carbon dioxide, carbon monoxide.

# **SECTION 11) TOXICOLOGICAL INFORMATION**

### Skin Corrosion/Irritation

Overexposure will cause defatting of skin.

Causes skin irritation

### Serious Eye Damage/Irritation

Overexposure will cause redness and burning sensation.

Causes serious eye irritation

# **Aspiration Hazard**

No data available

### Carcinogenicity

No data available

#### **Germ Cell Mutagenicity**

No data available

### **Reproductive Toxicity**

No data available

#### Respiratory/Skin Sensitization

No data available

### **Specific Target Organ Toxicity - Repeated Exposure**

No data available

### **Acute Toxicity**

Inhalation: effect of overexposure include irritation of respiratory tract, headache, dizziness, nausea, and loss of coordination. Extreme overexposure may result in unconsciousness and possibly death.

May be harmful in contact with skin

May be harmful if swallowed

# **Specific Target Organ Toxicity - Single Exposure**

May cause drowsiness or dizziness

0000079-20-9 METHYL ACETATE

LC50 (rat): 16000-32000 ppm (4-hour exposure) (9)

LD50 (oral, rat): greater than 5000 mg/kg (4)

LD50 (oral, rabbit): 3700 mg/kg (cited as 50 millimols/kg) (10)

LD50 (skin, rabbit): greater than 5000 mg/kg (4)

0000142-82-5 N-HEPTANE

LC50 (rat): approximately 25000 ppm (4-hour exposure); cited as 103 g/m3 (4-hour exposure) (6)

LD50 (oral, rat): Greater than 15000 mg/kg (4)

### **Potential Health Effects - Miscellaneous**

0000142-82-5 N-HEPTANE

Increased susceptibility to the effects of this material may be observed in people with preexisting disease of any of the following: central nervous system, respiratory system, skin. May cause central nervous system effects such as dizziness, headache, nausea, and loss of consciousness. Laboratory studies with rats have shown that petroleum distillates can cause kidney damage and kidney or liver tumors. These effects were not seen in similar studies with guinea pigs, dogs, or monkeys. Several studies evaluating petroleum workers have not shown a significant increase of kidney damage or an increase in kidney or liver tumors. Aspiration may occur during swallowing or vomiting, resulting in lung damage.

# **SECTION 12) ECOLOGICAL INFORMATION**

# **Toxicity**

No data available

# Persistence and Degradability

No data available.

### **Bio-Accumulative Potential**

No data available.

# **Mobility in Soil**

No data available.

# Other Adverse Effects

No data available.

# **Water Disposal**

Under RCRA, it is the responsibility of the user of the product, to determine at the time of disposal whether the product meets RCRA criteria for hazardous waste. Waste management should be in full compliance with federal, state, and local laws.

Empty containers retain product residue which may exhibit hazards of material, therefore do not pressurize, cut, glaze, weld or use for any other purposes. Return drums to reclamation centers for proper cleaning and reuse.

# **SECTION 14) TRANSPORT INFORMATION**

### **U.S. DOT Information**

UN number: UN1950

Proper shipping name: Aerosols, flammable, (each not exceeding 1 L capacity) (LTD QTY)

Hazard class: 2.1

### **IMDG Information**

UN number: UN1950

Proper shipping name: Aerosols, flammable, (each not exceeding 1 L capacity) (LTD QTY)

Hazard class: 2.1

# **IATA Information**

UN number: UN1950

Proper shipping name: Aerosols, flammable, (each not exceeding 1 L capacity) (LTD QTY)

Hazard class: 2.1

# **SECTION 15) REGULATORY INFORMATION**


CAS	Chemical Name	% By Weight	Regulation List
0000079-20-9	METHYL ACETATE	38% - 63%	SARA312,TSCA,ACGIH,OSHA
0000115-10-6	METHYL ETHER	17% - 29%	SARA312,VOC,TSCA
0000142-82-5	N-HEPTANE	2% - 4%	SARA312,VOC,TSCA,ACGIH,OSHA

# **SECTION 16) OTHER INFORMATION**

### Glossary

<sup>\*</sup> There are points of differences between OSHA GHS and UN GHS. In 90% of the categories, they can be used interchangeably, but for the Skin Corrosion/Irritant Category and the Specific Target Organ Toxicity (Single and Repeated Exposure) Categories. In these cases, our system will say UN GHS.

ACGIH- American Conference of Governmental Industrial Hygienists; ANSI- American National Standards Institute; Canadian TDG-Canadian Transportation of Dangerous Goods; CAS- Chemical Abstract Service; Chemtrec- Chemical Transportation Emergency Center (US); CHIP- Chemical Hazard Information and Packaging; DSL- Domestic Substances List; EC- Equivalent Concentration; EH40 (UK)-HSE Guidance Note EH40 Occupational Exposure Limits; EPCRA- Emergency Planning and Community Right-To-Know Act; ESL-Effects screening levels; HMIS- Hazardous Material Information Service; LC- Lethal Concentration; LD- Lethal Dose; NFPA- National Fire Protection Association; OEL- Occupational Exposure Limits; OSHA- Occupational Safety and Health Administration, US Department of Labor; PEL- Permissible Exposure Limit; SARA (Title III)- Superfund Amendments and Reauthorization Act; SARA 313- Superfund Amendments and Reauthorization Act, Section 313; SCBA- Self-Contained Breathing Apparatus; STEL- Short Term Exposure Limit; TCEQ- Texas Commission on Environmental Quality; TLV- Threshold Limit Value; TSCA- Toxic Substances Control Act Public Law 94-469; TWA- Time Weighted Value; US DOT- US Department of Transportation; WHMIS- Workplace Hazardous Materials Information System.

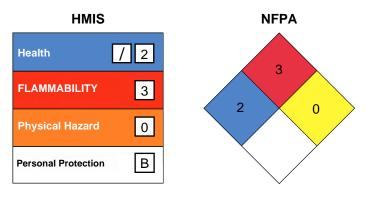

(\*) - Chronic effects

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks

# **DISCLAIMER**

To the best of our knowledge, the information contained herein is accurate. However, neither the above named supplier nor any of its subsidiaries assumes any liability whatsoever for the accuracy or completeness of the information contained herein. Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist. The above information pertains to this product as currently formulated, and is based on the information available at this time. Addition of reducers or other additives to this product may substantially alter the composition and hazards of the product. Since conditions of use are outside our control, we make no warranties, express or implied, and assume no liability in connection with any use of this information.